GD250 SERIES

CO GAS DETECTOR

PRODUCT SPECIFICATION SHEET



FEATURES

- High sensitivity and selectivity to carbon monoxide
- Low sensitivity to alcohol vapor
- Solid state sensor
- Linear 2 to 10 Vdc or 4 to 20mA output
- Compact size (70mm × 122mm × 32mm)

APPLICATION

GD250W3E/4E is IAQ(Indoor Air Quality) sensor, which has been designed to detect carbon monoxide gas in the air. This model has high accuracy at low concentration, so it optimum for parking lot, tunnel and under ground places. Also, the advantage of this model is compact size and easy installation.

Application	1
Features	1
Specification	
Dimensions	
Installation	2
Assembly	2
Wiring Diagram	3

Contents

SPECIFICATION

Table 1. Model selection guide

Model	Gas Detected	Sensing Range	Wiring
GD250W3E	Carbon monoxide (CO)	0050	3 wire
GD250W4E		0 ~ 250 ppm	4 wire

Gas detected : Carbon monoxide (CO)

Sensor type : Semiconductor

Detect range : 0~250ppm

: 1) +-5% FS @25C. 50% RH for

0~150ppm

Accuracy : 2) +- 10% FS @25C. 50%RH for

150~250ppm

Warm-up time : Minimum 2 hours
Power supply : 24Vac, 24Vdc

Output signal : 2~10Vdc or 4~20mA

Response time : Within 5 min.

Wiring : 3 or 4 wire

Operating temp. : -10 ~ 50 C.

Operating Humi. : 10 ~ 95%RH (no condensing)

Storage temp. : $-10 \sim 60 \text{ C}$.

Storage Humi. : 10 ~ 95%RH (no condensing)

DIMENSIONS

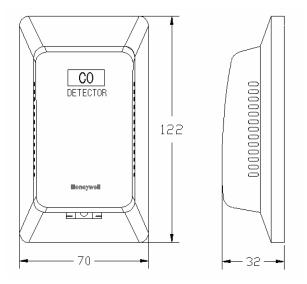


Fig. 1 GD250W3E/4E dimensions (mm)

INSTALLATION

- 1. Confirm the product type is 3-wire or 4-wire type by seeing the indicated model No. on the box.
- 2. Determine the output signal type.
 - →For DC voltage output(2~10VDC), connect Jumper(J1) to 'V' which is located in center of the PCB.

- →For current output(4~20 mA), connect Jumper(J1) to 'I' which is located in center of the PCB.
- Meson Default is DC voltage output(2~10VDC).
- 3. Install procedure
 - ① Push the bottom of the cover to separate from the base.
 - ② Connect the input and output lines to the terminal block. Then, verify the lines correctly fixed to the terminal.
 - ③ Fix the base by using the screw nails. Do not fix the base upside down. (Be cautious PCB assembly not to be damaged.)
 - ④ Reassemble the cover.
- 4. Mount approximately 150cm (5 feet) above floor.
- 5. Do not use as a life safety device.
- 6. Do not apply the 4-wire type for the 3-wire type usage.
- 7. When the product has wet by dew, use the product after completely dry up.
- 8. Install the input and output lines far away form other system-input lines.
- 9. Do not use this product for portable.

ASSEMBLY

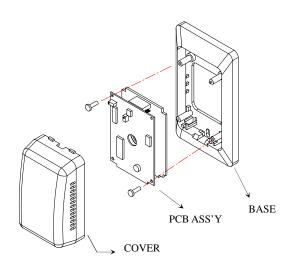
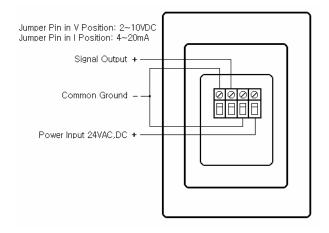


Fig. 2 GD250W3E/4E assembly

WIRING DIAGRAM



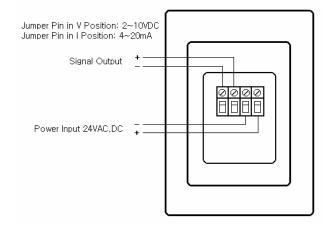


Fig. 3 GD250W3E/4E wiring diagram (3 wire)

Fig. 4 GD250W3E/4E wiring diagram (4 wire)

JUMPER(J1) Setting Method to Determine the Output Signal Type

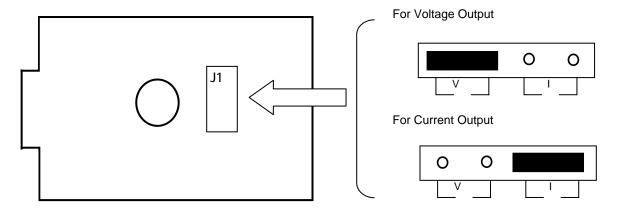


Fig. 5 GD250W3E/4E jumper setting

- The standard test condition is 25 $^{\circ}$ C, 65%RH. Sensitivity will be decreased when the sensor is located in extreme dry condition or places.
- Avoid exposure where silicone adhesives, hair grooming materials or silicone rubber/putty may be present.
- Avoid exposure to alkaline metals, especially salt-water spray.
- Avoid exposure to highly corrosive materials such as H₂S, SO_X, Cl₂, HCl, etc.
- Sensor drift may occur due to soaking or splashing the sensor with water.
- If water freezes on the sensing surface, the sensing material would crack, altering characteristics.
- If water condenses on the sensor's surface and remains for an extended period, sensor characteristics may drift.
- Sensor performance may be affected if exposed to high density of gas for a long period of time, regardless of the powering condition.
- When stored without powering for a long period, the sensor should be stored in a sealed bag containing clean air, do not use silica gel.
- Regardless of powering condition, if the sensor is exposed in extreme conditions such as very high humidity, extreme temperatures, or high contamination levels for a long period of time, sensor performance will be adversely affected.
- Avoid excessive vibration or strong shock that may cause the sensor or lead wires to break.



Tel. 82-2-799-6170/6194

Fax. 82-2-792-9013